

Exporter Plus Software 1.10.0

General Remarks:

Exporter Plus Software Version 1.10.0 is a Software update suitable for all Nautel Exporter Plus units.

This release is **NECESSARY** for those who require features that are enabled through licensing. Nautel recommends you upgrade at your earlier convenience, **during your next scheduled site visit**.

You can download Exporter Plus Software Version 1.10.0 [here](#).

Software Upgrade procedure can be found in *Exporter Plus Technical Instruction Manual Iss. 1.0 – Section 8* located [here](#). Please be sure to review and understand the complete set of instructions prior to beginning your upgrade.

Note: See your manual's *Software Upgrade Procedure* for the configuration details to understand considerations around your upgrade scenario in advance of upgrading to Exporter Plus SW 1.10.0.

New Features:

- Exporter Plus is now licensed by default.
 - Remote Configurations are now enabled by default.

Known Issues:

- If the Audio Monitor source is set to Delayed Analog, the maximum Diversity Delay is 10 seconds, no matter the setting.
 - **CAUTION:** If the Audio Monitor source is set to Delayed Analog, playing audio and changing the Diversity Delay from 15 to 20 seconds may result in the Exporter Plus freezing and then turning off approximately one minute later. Avoid this setting.
 - To recover from this behaviour if set in error, ac cycle the unit and change the Diversity Delay to 10 seconds or less.
- The Diversity Delay value viewed on the UI will not settle on a value and will continuously bounce around the target delay time.
 - Diversity Delay functionality is not affected.
- In addition to the Diversity Delay value issue, if “Always Blend” is selected under Blend Control, the “Diversity Delay Ramping” alarm will be constantly shown.
 - Diversity Delay functionality is not affected.
- The string “RemoteConfiguration is enabled” is not displayed in View Software Features, however the Remote Configurations are enabled.

Workarounds:

None at this time.

Installation Considerations:

This software update will take approximately 30 minutes. You will be OFF AIR during the upgrade process.