



Nautel Exporter Plus Release Notes

Exporter Plus Series Software 1.10.1 Release Notes

General Remarks:

Exporter Plus Series Software Version 1.10.1 is a Software update for Nautel Exporter Plus units (see note for compatibility).

This release is **NECESSARY** for those who require any of the bug fixes/improvements identified below. Nautel recommends you upgrade at your earliest convenience, **during your next scheduled site visit**.

You can download Exporter Plus Series Software Version 1.10.1 [here](#).

Software Upgrade procedure can be found in *Exporter Plus Technical Instruction Manual Iss. 1.0 – Section 8* located [here](#). Please be sure to review and understand the complete set of instructions prior to beginning your upgrade.

Note: See your manual's *Software Upgrade Procedure* for the configuration details to understand considerations around your upgrade scenario in advance of upgrading to the latest Exporter Plus release.

New Features:

None at this time.

Improvements / Enhancements:

None at this time.

Removed / Retired Features:

None at this time.

Bug Fixes:

- Disabled the “Diversity Delay Ramping” alarm when “Always Blend” is selected under Blend Control.
 - Due to constant Diversity Delay ramping towards the target, the “Diversity Delay Ramping” alarm would constantly be triggered.
 - Diversity Delay functionality was not affected.

Known Issues:

- If the Audio Monitor source is set to Delayed Analog, the maximum Diversity Delay is 10 seconds, no matter the setting.
 - **CAUTION:** If the Audio Monitor source is set to Delayed Analog, playing audio and changing the Diversity Delay from 15 to 20 seconds may result in the Exporter Plus freezing and then turning off approximately one minute later. Avoid this setting.
 - To recover from this behaviour if set in error, ac cycle the unit and change the Diversity Delay to 10 seconds or less.
- The string “RemoteConfiguration is enabled” is not displayed in View Software Features, however the Remote Configurations are enabled.
- The “Host” version is incorrectly labelled as 1.10.0 and is in fact 1.10.1. However, “ExpPlus” is correctly labelled as 1.10.1. No functionality is affected.



Nautel Exporter Plus Release Notes

Workarounds:

None at this time.

Installation Considerations:

This software update will take approximately 30 minutes. You will be OFF AIR during the upgrade process.

Exporter Plus Series Software 1.10.0 Release Notes

General Remarks:

Exporter Plus Series Software Version 1.10.0 is a Software update suitable for all Nautel Exporter Plus units.

This release is **NECESSARY** for those who require features that are enabled through licensing. Nautel recommends you upgrade at your earliest convenience, **during your next scheduled site visit**.

You can download Exporter Plus Series Software Version 1.10.0 [here](#).

Software Upgrade procedure can be found in *Exporter Plus Technical Instruction Manual Iss. 1.0 – Section 8* located [here](#). Please be sure to review and understand the complete set of instructions prior to beginning your upgrade.

Note: See your manual's *Software Upgrade Procedure* for the configuration details to understand considerations around your upgrade scenario in advance of upgrading to Exporter Plus SW 1.10.0.

New Features:

- Exporter Plus is now licensed by default.
 - Remote Configurations are now enabled by default.

Improvements / Enhancements:

None at this time.

Removed / Retired Features:

None at this time.

Bug Fixes:

None at this time.

Known Issues:

- The string "RemoteConfiguration is enabled" is not displayed in View Software Features, however the Remote Configurations are enabled.

Workarounds:

None at this time.



Nautel Exporter Plus Release Notes

Installation Considerations:

This software update will take approximately 30 minutes. You will be OFF AIR during the upgrade process.