



Nautel Software Bulletin

July 9, 2014

Nautel GV Series V4.0.3 Release Notes

Nautel strongly recommends that customers upgrade to GV version 4.0.1 or higher as soon as possible.

Improvements with this release include:

- Resolved an issue where "No Reverse Path" alarm would never clear once set, causing erratic behaviour and potential overshoots; specifically when ac mains quickly switched over to generator power.
- Resolved erroneous exciter changeovers in FM mode at minimum power (was due to error between exciter power measurement and transmitter RF drive power measurement).

The most significant improvements with previous versions include:

Version 4.0.2 – Released June 2 2014

- Resolved an erroneous Monitor Fan Fail alarm condition.

Version 4.0.1 – Released April 14, 2014

- Reduced transmitter output power overshoot behaviour when HD data is lost.
- Fixed SBC Watchdog Reset function.
- Prevented transmitter output power from overshooting if the Spectrum/Efficiency Optimizer function is disabled after the system has been optimized.

Nautel Software Bulletin

Recipients of Nautel bulletins will receive information on software updates, product notices and other information affecting users of Nautel equipment.

Nautel Customer Service

Tel: 1-877-662-8835

Intl: 1-902-823-3900

support@nautel.com

[Start an online chat session with Customer Service \(7:30 AM – 7:30 PM EST\)](#)

Follow the link below for the latest files. Files may be safely transferred using flash drives or "copy and paste"

[GV Series Software V4.0.3](#)

For record keeping purposes please notify customer service via email when software update is complete.

support@nautel.com

www.nautel.com