



# Nautel Software Bulletin

September 20, 2012

On September 20, 2012 Nautel released version 2.9.2

The most significant improvements with this version include:

## Software Version 2.9.2

- Resolves issue observed in Combined NV transmitter controlled by SCI, where the analog power cal factor was not being updated correctly in all cases. This release only affects combined systems operating in IBOC modes.
- Resolved issue where a false Combiner Match alarm would occur if a quick AC interruption occurred (where a Low AC Alarm was not detected) and the transmitter control system was being powered by an external UPS.
- Resolved issue where the transmitter, while operating in FM+HD or HD mode, would not recover if a quick AC interruption occurred (quick enough where a Low AC Alarm was not detected) and the transmitter control system (specifically the exciter) was being powered by an external UPS.

## Software Version 2.9.1

- Fixes nuisance Combiner Matching Shutdown alarms during ramp-up.
- Changes default Low IPA Output Power threshold from 65W (was 70W) to 55W in order to resolve a ramp-up issue where the open loop IPA voltage would not result in sufficient average IPA output power to activate IPA ALC.

## Nautel Software Bulletin

Recipients of Nautel bulletins will receive information on software updates, product notices and other information affecting users of Nautel equipment.

## Nautel Customer Service

Tel: 1-877-662-8835  
Intl: 1-902-823-3900

[support@nautel.com](mailto:support@nautel.com)

[Start an online chat session with Customer Service \(7:30 AM – 7:30 PM EST\)](#)

Follow the link below for the latest files. Files may be safely transferred using flash drives or “copy and paste”.

[NV Series Software V2.9.2](#)

For record keeping purposes please notify customer service via email when software update is complete.